MITSUBISHI MOTORS

SERVICE BULLETIN

GLOBAL AFTER SALES OFFICE. MITSUBISHI MOTORS CORPORATION

PURPOSE : INFORMATION	ISSUE NO. : MSB-12EXL00-005	DATE : 2012-07-13
SUBJECT : INFORMATION ON 2013 PAJERO SPORT/NATIVA/MONTERO SPORT/CHALLENGER		<Destination/Model> (G.EXP/GCC/THAI/MMAL/NZ/RUSSIA/MEXICO) "KH8W" <M/Y> 13
GROUP : GENERAL		

1. Description:

This Service Bulletin contains the information about the 2013 PAJERO SPORT/NATIVA/MONTERO SPORT/CHALLENGER Body Repair Manual.

2. Applicable manual:

Applicable manual	Pub. No.	Contents
2009 PAJERO SPORT/NATIVA/MONTERO SPORT/CHALLENGER BPDY REPAIA MANUAL	G.EXP/GCC PWJE0808R-2(ENG)PWJS0809R-2(SPA) THAI/NZ/MEXICO/DRAFT RUSSIA:N/A MMAL:DRAFT	Attached sheet

3. Details:

See Attached sheets

GROUP 1

BODY CONSTRUCTION

CONTENTS

GENERAL INFORMATION 1-2

BODY CONSTRUCTION CHARACTERISTICS 1-2

FENDER SHIELD 1-2

SILENCER APPLICATION LOCATIONS 1-3

GENERAL INFORMATION

M4010000200653

The section "FENDER SHIELD" and ''SILENCER APPLICATION LOCATIONS'' below have been changed.

BODY CONSTRUCTION CHARACTERISTICS

FENDER SHIELD

M4010000400185

Due to the addition of models conforming to emission standard Euro5, a DPF pipe bracket has been added.

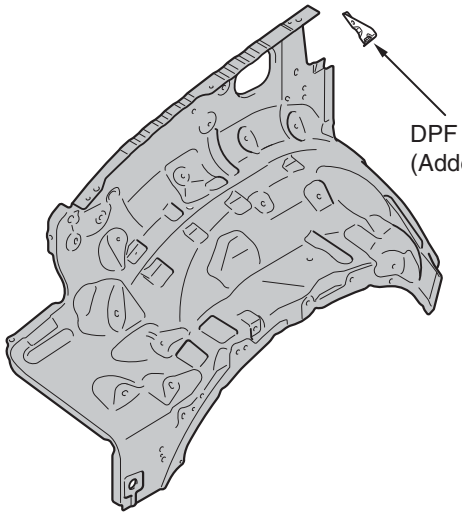

NOTE: ▭: Indicate same parts as for previous models.

ABC00188AB

SILENCER APPLICATION LOCATIONS

M4010005002638

In order to suppress noise, a silencer (melting sheet) has been adhered on the dash panel.<Vehicles for Australia and New Zealand (option)>

DASH PANEL

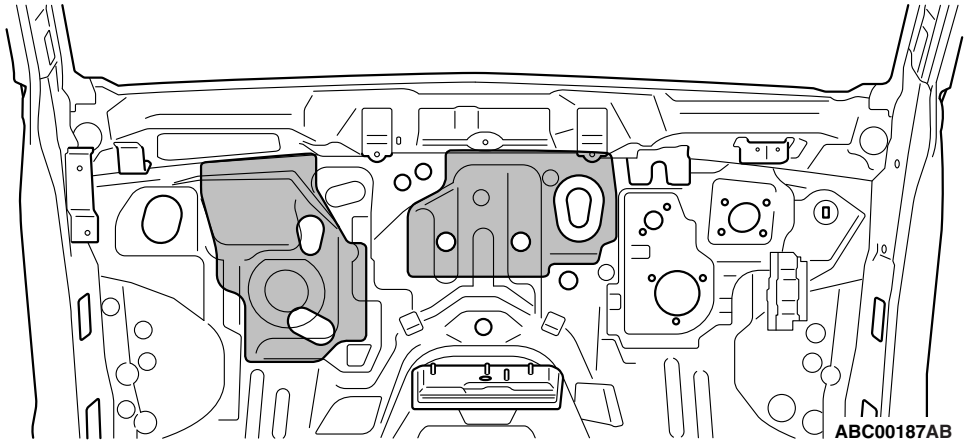

NOTE :

: 2.0 mm thick melting sheet (Place two melting sheet one on top of another.)

( ) indicates the number of 1.6 mm thick melting sheets that are used for repair.