SERVICE BULLETIN

MITSUBISHI MOTORS

GLOBAL AFTER SALES OFFICE, MITSUBISHI MOTORS CORPORATION

PURPOSE : CORRECTION	ISSUE NO. : MSB-15EXL14-501	DATE : 2015-02-03
SUBJECT : Error in writing of the part number of the radiator cap tester adapter set “MB992190”(Special tool)		<DESTINATION/MODEL> (EU/MMAL/NZ) <M/Y> 14-14.5
GROUP : Gr:14(Cooling)		Outlander PHEV(GG0W)

1. Description :

Please refer to the attached document for the correction of the error in writing existing in the applicable service manual. The correct part number is as shown below :

(Correct)		(Error)	
MB993001	←	MB992190	Special too “Radiator cap tester adapter set”

2. Affected service manuals :

As per attached sheet 1

3. Details :

As per attached sheets 5-7

Attached sheet 1



For overseas market
EU

Applicable manual	Pub. No.	Applicable title(Info-ID)	Contents
2014 OUTLANDER/ OUTLANDER PHEV Workshop Manual	CGFE14E2-CD(English) CGFF14E2-CD(French) CGFG14E2-CD(German) CGFS14E2-CD(Spanish) CGFI14E2-CD(Italian)	SPECIAL TOOL (M142-00-060-04500-01)	Attached sheet 5
		MOTOR COOLANT LEAK CHECK (M142-00-100-04600-01)	Attached sheet 6
		EV RADIATOR CONDENSER TANK CAP VALVE OPENING PRESSURE CHECK (M142-00-130-05800-01)	Attached sheet 7
2014.5 OUTLANDER/ OUTLANDER PHEV Workshop Manual	CGFE14E3-CD(English) CGFF14E3-CD(French) CGFG14E3-CD(German) CGFS14E3-CD(Spanish) CGFI14E3-CD(Italian)	SPECIAL TOOL (M142-00-060-04500-01)	Attached sheet 5
		MOTOR COOLANT LEAK CHECK (M142-00-100-04600-01)	Attached sheet 6
		EV RADIATOR CONDENSER TANK CAP VALVE OPENING PRESSURE CHECK (M142-00-130-05800-01)	Attached sheet 7

AUSTRALIA, NEW ZEALAND


Applicable manual	Pub. No.	Applicable title(Info-ID)	Contents
2014 OUTLANDER/ OUTLANDER PHEV Workshop Manual	AU900408 (AUSTRALIA), DRAFT(NEW ZEALAND)	SPECIAL TOOL (M142-00-060-04500-01)	Attached sheet 5
		MOTOR COOLANT LEAK CHECK (M142-00-100-04600-01)	Attached sheet 6
		EV RADIATOR CONDENSER TANK CAP VALVE OPENING PRESSURE CHECK (M142-00-130-05800-01)	Attached sheet 7

Attached sheet 5

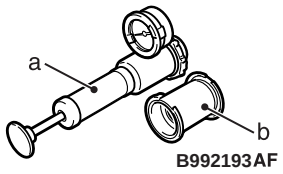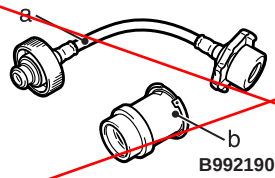	MB992193	Radiator cap tester a: Tester b: Adapter	• Motor coolant leak check • Radiator condenser tank cap valve opening pressure check
	MB992190	Radiator cap tester adapter set a: System adapter b: Cap adapter	

<Incorrect>

<Correct>

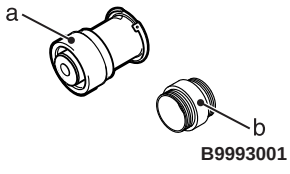
	MB993001

Attached sheet 6

MOTOR COOLANT LEAK CHECK

Observe either of the procedures below to pressurise the water-cooling system.

1. When the special tool radiator cap tester is not used
   (1) Start the "Coolant refilling control" (refer to Coolant Refilling).
2. When the special tool radiator cap tester is used
   (1) Use the special tool below.
   - Radiator cap tester (MB992193)
     - A: Tester
     - B: Adapter <Deleted>
   - Radiator cap tester adapter set (MB992190) <Incorrect>
     - A: System adapter

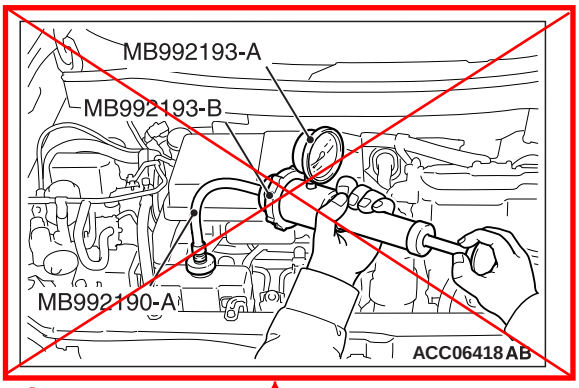

<Incorrect>


(MB993001) <Correct>

CAUTION

Do not pressurise 44 kPa or more.

   (2) Mount the special tool to the EV radiator condenser tank, and perform the pressurisation.
3. Check the EV radiator, the electric water pump, the hoses or pipes for motor coolant leakage.

<Correct>

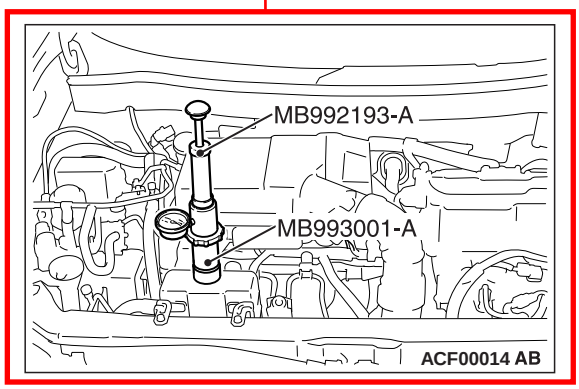


Attached sheet 7

EV RADIATOR CONDENSER TANK CAP VALVE OPENING PRESSURE CHECK

1. Use the special tool below.
   - Radiator cap tester (MB992193)
     - A: Tester
   - Radiator cap tester adapter set (MB992190)
     - B: Cap adapter

<Incorrect>

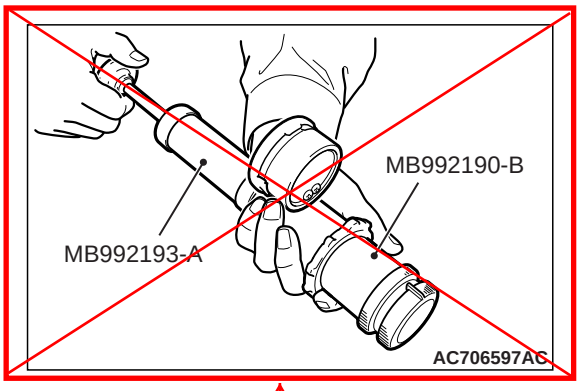

CAUTION

After checking for any foreign material deposition to the radiator condenser tank cap seal, be sure to apply water.

2. Install the radiator condenser tank cap to the special tool, and check that the valve opening pressure is within the standard value.

   Standard value: 14 – 44 kPa

3. If not within the standard value, replace the EV radiator condenser tank cap.

<Correct>

- Radiator cap tester adapter set (MB993001)
  - A: System adapter
  - B: Cap adapter

<Correct>

