SERVICE BULLETIN

MITSUBISHI MOTORS

DOMESTIC SALES & AFTER SALES SERVICE OFFICE, MITSUBISHI MOTORS CORPORATION

PURPOSE : INFORMATION	ISSUE NO. : MSB-10E00-006	DATE : 2010-06-05
SUBJECT : INFORMATION ON 2011 LANCER AND LACER SPORTBACK FOR BODY REPAIR MANUAL		<MODEL> (EUR/RUSSIA) LANCER (CY0A) LANCER SPORTBACK (CX0A) <M/Y> 11
GROUP : GENERAL		

1. Description:

This Service Bulletin contains the information regarding the 2011 LANCER AND LANCER SPORTBACK.

2. Applicable Manual:

Manual	Pub. No.	Attached Sheet
2011 LANCER Body Repair Manual	CG1E11E1-CD (ENGLISH) CG1S11E1-CD (SPANISH) CG1F11E1-CD (FRENCH) CG1G11E1-CD (GERMANY) CG1I11E1-CD (ITALIAN)	Attached sheet
2011 LANCER SPORTBACK Body Repair Manual	CG4E11E1-CD (ENGLISH) CG4S11E1-CD (SPANISH) CG4F11E1-CD (FRENCH) CG4G11E1-CD (GERMANY) CG4I11E1-CD (ITALIAN)	

3. Details:

See Attached sheet.

1. BODY CONSTRUCTION

GENERAL INFORMATION

M4010000200460

OUTLINE OF CHANGE

The section "SILENCER APPLICATION LOCATIONS" has been established.

SILENCER APPLICATION LOCATIONS <LANCER>

M4010005002531

A silencer (MD-12 and melting sheet) has been affixed on the upper surface of the floor for vibration damping.

NOTE: MD-12 is a high-performance sheet made of asphalt, to which mica, heat cured resin, and so on are added to improve damping performance.

<1800 Petrol engine (Vehicles for Russia)>
<2000 Petrol engine (Vehicles for Russia)>

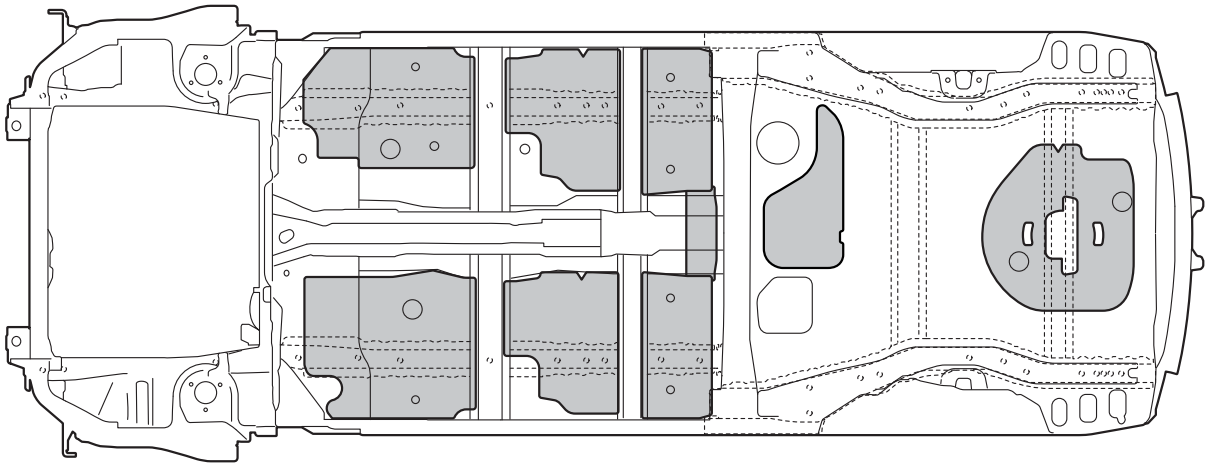

NOTE :
: 1.6 mm thick melting sheet

ABA00028AB

<Optional item >

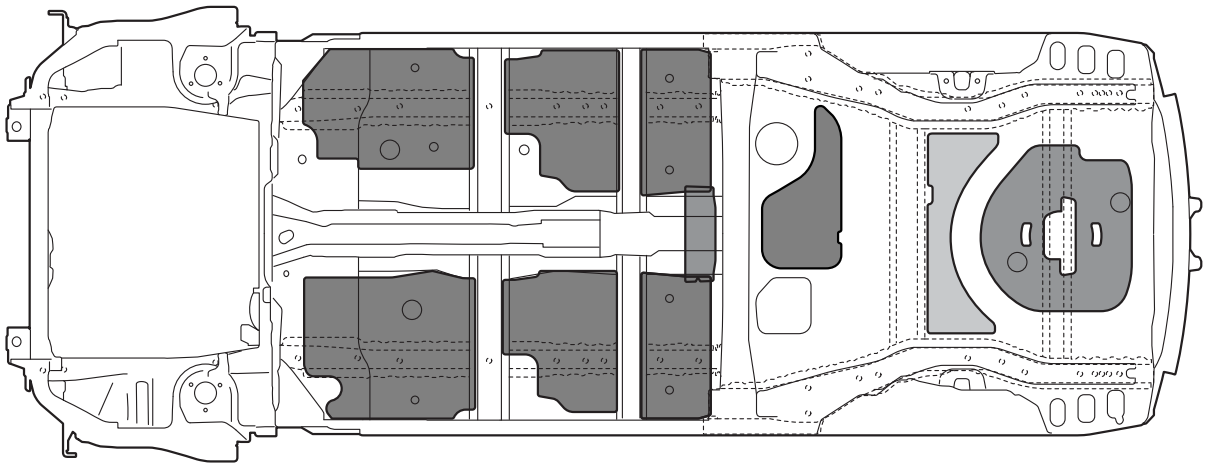

NOTE :
: 1.6 mm thick melting sheet
: 3.2 mm thick melting sheet (Place two melting sheet one on top of another.)
( ) indicates the number of 1.6 mm melting sheets that are used for repair.

ABA00029AB

<Petrol engine (Vehicles for Europe)>
<1500 Petrol engine (Vehicles for Russia)>
<RALLIART>

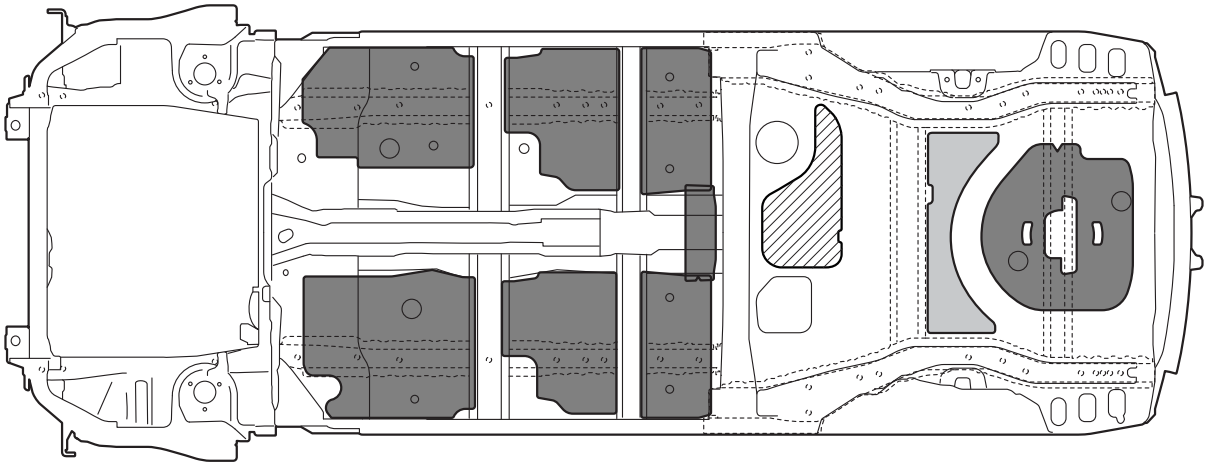

NOTE :
: 1.6 mm thick melting sheet
: 3.2 mm thick melting sheet (Place two melting sheet one on top of another.)
: 6.0 mm thick melting sheet (Place four melting sheet one on top of the next.)
( ) indicates the number of 1.6 mm melting sheets that are used for repair.

ABA00031AB

<1800 Diesel engine>
<Petrol engine and RALLIART (Optional item)>

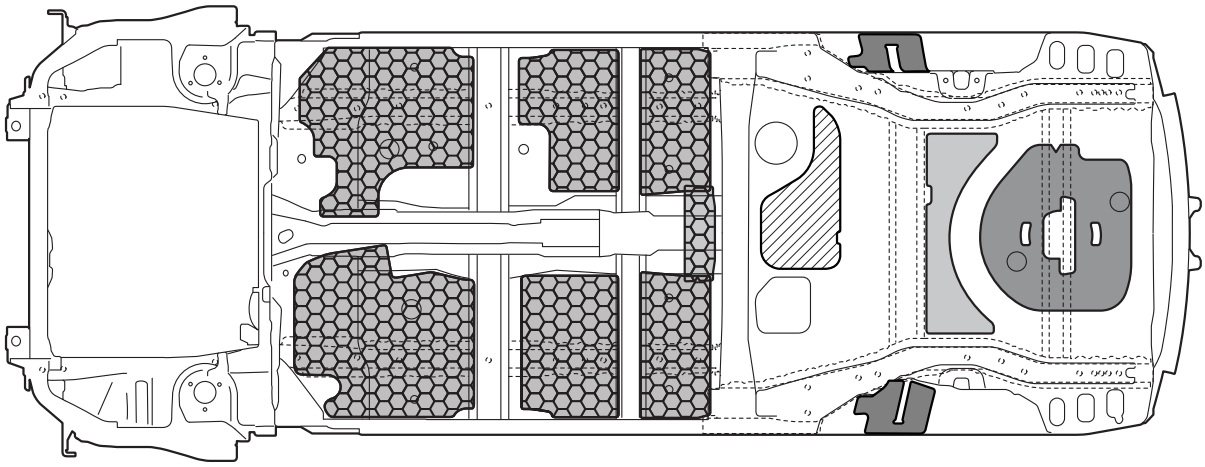

NOTE :
: 1.6 mm thick melting sheet
: 3.2 mm thick melting sheet (Place two melting sheet one on top of another.)
: 3.2 mm thick MD-12 (Place two melting sheet one on top of another.)
: 6.0 mm thick melting sheet (Place four melting sheet one on top of the next.)
( ) indicates the number of 1.6 mm melting sheets that are used for repair.

ABA00049AC

SILENCER APPLICATION LOCATIONS <LANCER SPORTBACK>

M4010005002519

A silencer (MD-12 and melting sheet) has been affixed on the upper surface of the floor for vibration damping.

NOTE: MD-12 is a high performance sheet composed of asphalt applied with mica and thermosetting resin for improving anti-vibration performance.

<Vehicles for Europe (Petrol engine) and optional item for Russia>
<RALLIART>

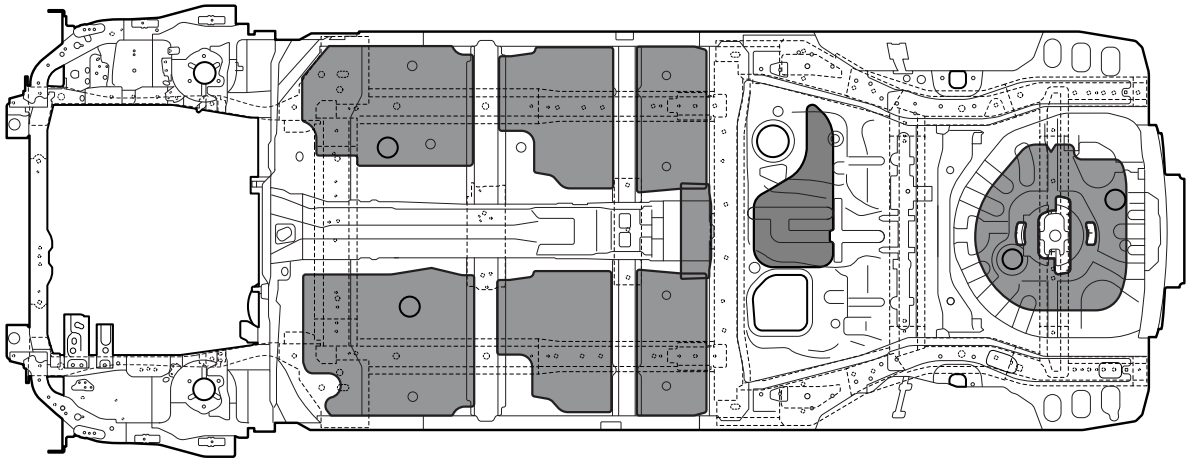

NOTE:
: 3.2 mm thick melting sheet (Place two melting sheet one on top of another.)
( ) indicates the number of 1.6 mm melting sheets that are used for repair.

ABA00033AB

<Vehicles for Russia (Except RALLIART)>

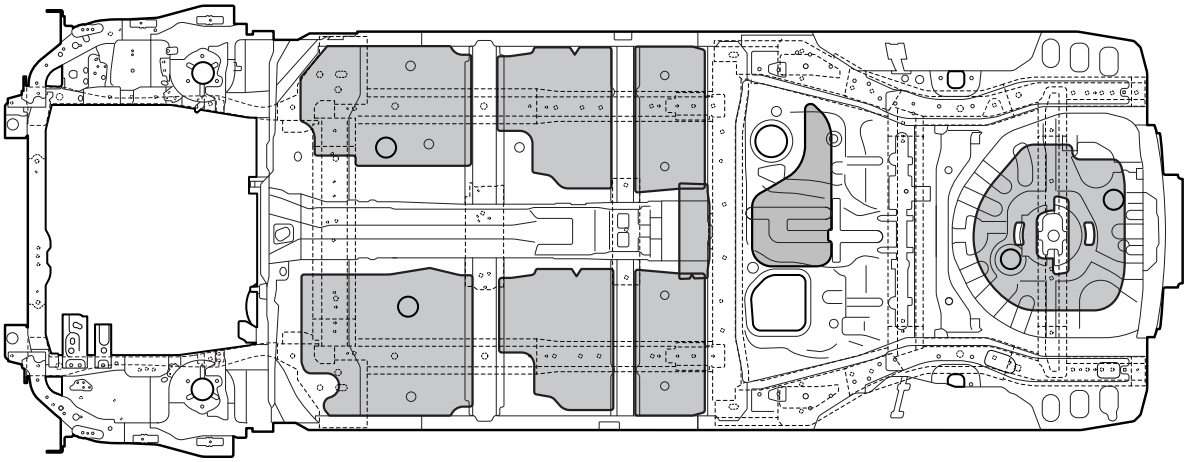

NOTE:
: 1.6 mm thick melting sheet

ABA00034AB

<Vehicles for Europe (diesel engine)>
<Optional item for Petrol engine (Vehicles for Europe) and for Russia>

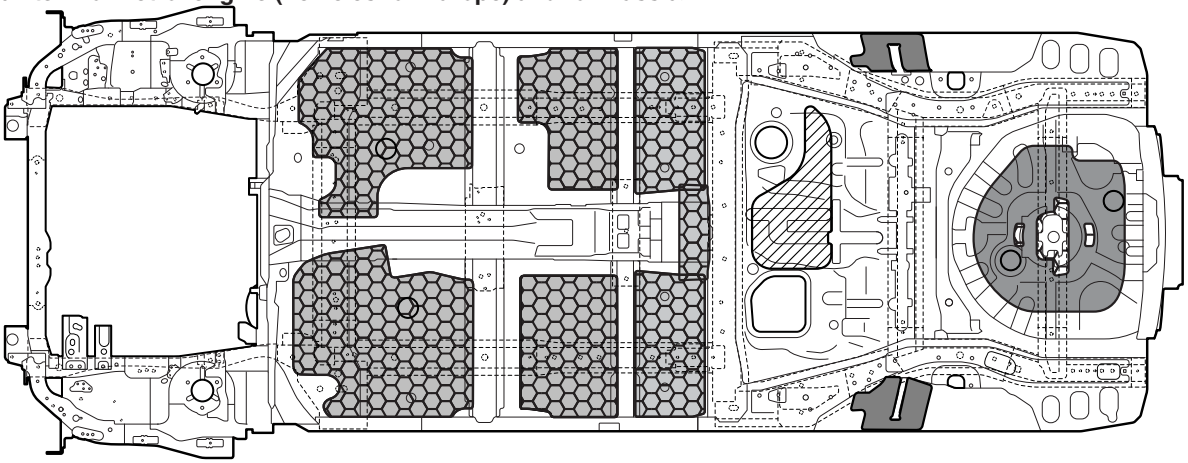

NOTE:
: 3.2 mm thick melting sheet (Place two melting sheet one on top of another.)
: 3.2 mm thick MD-12 (Place two 1.6 mm melting sheet one on top of another.)
: 6.0 mm thick melting sheet (Place four melting sheet one on top of the next.)
( ) indicates the number of melting sheets that are used for repair.

ABA00048AC